

Entry Permit Holder Report

SafeWork SA

Application ID 22515052

Entry Permit Holder	
Full Name:	Cody Hastings
Permit Number:	ET 2500877
Union Represented:	CFMEU Construction Division
Worksite Entered	
Business Name:	Prospect Corner - Kennett Construction
Industry:	Construction
Address:	250B Churchill Rd, Prospect, Sth Australia - job in the North West part of Prospect Corner, currently made up of multiple smaller jobs.
Date workplace entered:	10/11/2025

I Cody Hastings am of the opinion that the PCBU has contravened the WHS legislation relating to:

	Suspected Contravention	More information	Was the contravention rectified?
PCBU Alleged Contravention 1	Not maintaining a safe work environment	Jobsite from level 1 and up only has one non-powered means of access egress, with secondary access being the personnel hoist. If there was a fire on-site, or something else occurred to knock out power, or the personnel hoist broke down, the personnel hoist would not be usable, meaning there is only a singular access in an emergency situation. Builder believes this is adequate.	No

		It is our view that sites should have at least two non-powered means of access and egress.	
PCBU Alleged Contravention 2	Not maintaining a safe work environment	<p>Jobsite has multiple ladder access scaffold towers, going up the height of the building -approx. 7 stories, with the only access being at the base of each tower.</p> <p>We raised concerns about the workers being able to egress from the scaffold tower, should something happen to block off access at the bottom. The builder would be able to build access from the levels to the scaffold tower, but the builder did not indicate whether they would do this.</p> <p>Builder could not provide design or engineering paperwork for the scaffold towers.</p>	No
PCBU Alleged Contravention 3	Not maintaining safe plant and structures	<p>Worksite has several portions of edge protection which is not compliant due to the following reasons</p> <ul style="list-style-type: none"> - brick screens are installed on the outside of the edge protection, and is only held in place by tie wire - not rated. Should the brick screen dislodge, it would likely fall over the top of a work or access area. - Handrail is not installed properly, ie base plate only has a single bolt fixing it in. This especially an issue for 2m tall handrail, which would traditionally require engineering, and none was provided. - One window on the Northern side was using 13mm plywood as its edge protection, however this was only loosely fixed to the wall, and came loose after light movement. - Some portions either had no kicker, or the kicker was greater than 10mm above the floor height. - Edge protection where the Prestons were taken out is grossly inadequate, and is currently relying on flagging 	No

		wrapped around aluminium stud framework.	
PCBU Alleged Contravention 4	Not maintaining safe plant and structures	<p>Western Scaffold stretcher stair, which the builder is currently relying on for their secondary access to the levels, with the personnel hoist being their primary, - which we disagree with - , was found to be past its monthly inspection date by at least 7 days.</p> <p>When the builder became aware, they tagged the stretcher stair as out of use, and cleared the working levels while the inspection of the scaffold took place.</p>	Yes
PCBU Alleged Contravention 5	Not maintaining a safe work environment	Tilers were found to be using grinders to cut tiles, with no dust extraction in place, nor was there appropriate PPE. Builder stopped the worker, but a better system is needed to also protect other workers from dust.	No