

Entry Permit Holder Report

SafeWork SA

Application ID 21935565

Entry Permit Holder	
Full Name:	Cody Hastings
Permit Number:	ET 2500877
Union Represented:	CFMEU (C&G Division)
Worksite Entered	
Business Name:	Unley 108 / Catcorp
Industry:	Construction
Address:	108 Unley Road, Unley, SA
Date workplace entered:	11/8/25

I Cody Hastings am of the opinion that the PCBU has contravened the WHS legislation relating to:

	Alleged Contravention	More information	Was the contravention rectified?
PCBU Alleged Contravention 1	Unsafe use, handling and storage of plant, structures and substances	On Friday 8/8/25 scaffold/hoarding along Unley Road was struck by a truck exiting site. Upon inspection of scaffold/hoarding, it was found that the scaffold/hoarding had been modified while attempting to clean up/rectify site following the incident. Site was open, and walkway under hoarding was open, although no engineers report had been made on scaffold hoarding, and there still	No

		remained damaged pieces of scaffold from the incident. Site team informed of need to get an engineers report done, or replace the scaffold.	
PCBU Alleged Contravention 2	Not maintaining a safe work environment	Site did not have two means of access/egress to level 1 deck. Site team was in the process of installing a ladder as we were leaving.	Yes
PCBU Alleged Contravention 3	Lack of information, training, instruction or supervision	Prohibition notices and provisional improvement notices that had been placed on site were not displayed as required, site team informed of requirement, and site team said they intend to display them in the lunch room (but had not done so at that stage).	No
PCBU Alleged Contravention 4	Not maintaining safe plant and structures	Scaffold/hoarding soleboards along Unley Rd were not centred under the majority of standards, with some soleboards installed in a non-compliant fashion, ie soleboard propped up by laminate timber, or cracks in the soleboards.	No
PCBU Alleged Contravention 5	Not maintaining safe plant and structures	On the level one deck there were multiple areas missing kickers, and handrails were installed in non compliant fashion, ie splitting timbers, timbers attached together with no upright staunchons or inadequate staunchons. Builder addressed some areas, but not all, this has been a constant issue.	No